
Page 1

Accept

[illegible]**Setup Start**

Stop

Cust Item ID:

11-11-11

Customer:

Reference:

Date _____

Tooling:

Date:

Run Start

QC:

Date:

SPC (Y/N):

Date:

Stop

John CL 10/07/21

8.06.07/21

(IX) Q MB 10-06-30

IX 2 MB 10-06-30

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 60146

Monday, June 28, 2010 9:03:35 AM



Page 2

Item ID: D407-667-105

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Fwd

Start Date: 6/28/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 7/9/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool # Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

130

QC15- Crosstube Dimensional Check

0.00

8/10/07/01



QC

Memo

0.00

Quality Control

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DCA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 60146

Monday, June 28, 2010 9:03:35 AM



Page 3

Item ID: D407-667-105

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Fwd

Start Date: 6/28/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 7/9/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

140

0.00



Crosstubes

Crosstubes

Memo

0.00

Crosstubes

1- scribe batch # inside of cuff

2-Drill pilot holes in tube using drill Jig DT8541 & DT8542 as per Dwg D407-667-145. Drill all (3) top holes use drill table jig DT8577 hole #1,#11 to set up towers, as per QSI0010.

3-Drill and Ream all holes in tube to finish size using drill Jig DT8541 & DT8542 as per Dwg D407-667-145 Check dimensions between holes on all four sides.

4-Flip tube and switch drilling Jigs from right to left, left to right. Locate Jigs off existing holes using "T" pins.

5-Drill pilot holes using drill Jig DT8541 & DT8542 as per Dwg 407-667-145. Drill only the top (2) holes.

6-Drill & ream the top (2) holes to finish size using drill Jig DT8541 & DT8542 as per Dwg D407-667-145

7-Drill Fwd rivet holes using drill Jig DT8787FWD as per Dwg D206-667-145.Note: Fwd side has 3x top holes.

8-Drill Aft rivet holes using drill Jig DT8787AFT as per Dwg D407-667-145.

9-C'sink holes as per Dwg D407-667-145. Allow rivet to sit below surface to compensate for paint.

10-Deburr & Inspect for surface damage. Repair damage within limits as per

10-07-05
10-07-06 - GWM

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector	
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Work Order ID 60146

Monday, June 28, 2010 9:03:35 AM

Page 4

Item ID: D407-667-105

Accept

Setup Start

Revision ID:

Stop

Item Name: Crosstube Fwd

Start Date: 6/28/2010 Start Qty: 1.00

Required Date: 7/9/2010 Req'd Qty: 1.00

Cust Item ID:

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Dwg D407-667-145

150

Crosstubes Chemical Conversion

0.00



HandFXtube

Memo

0.00

Hand Finishing Crosstubes

1 - - *AWM*
1907/06

160

QC3- Inspect Part Finish

0.00



QC

Memo

0.00

Quality Control

8/6/07

170

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

*8/6/07**(4)*

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector	
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Work Order ID 60146

Monday, June 28, 2010 9:03:35 AM

Page 5

Item ID: D407-667-105

Accept

Setup Start

Revision ID:

Stop

Item Name: Crosstube Fwd

Start Date: 6/28/2010 Start Qty: 1.00

Cust Item ID:

Required Date: 7/9/2010 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

180

Outsource process - NDT per QSI038 4.1

0.00



Outsource2

Memo

0.00

Outsource process - NDT

OUTSIDE SERVICE -CROSSTUBES
Liquid Penetrant Inspection as per QSI 038 Or
Issue P/O: 12212 LPI as per ASTM 1417
Level 2 Attach copy of NDT results to work order

CY 10/7/7 ①

190

Packaging

0.00



Packaging

Memo

0.00

Packaging

Inspect for transit damage
Ensure copy of NDT results attached to work order.

P 6/7/8 ①

200

QC 5 Inspect dimensions to drawing

0.00



QC

10.07.13

Memo

0.00

Quality Control

Inspect for damage & ensure results are as per Dwg D206-667-145

BX 10-07-13

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 60146

Monday, June 28, 2010 9:03:35 AM



Page 6

Item ID: D407-667-105

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Fwd

Start Date: 6/28/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 7/9/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

210

0.00



SprayPaint

SprayPaint

Memo

0.00

Spray Painting

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube with White Imron as per QSI 005 4.2

PRIME:

Start Time: 11:00

Finish Time: 2:00

PAINT:

Start Time: 3:00

Finish Time: 4:00

10-07-13

220

QC14- Inspect Spray Paint

0.00



QC

Memo

0.00

Quality Control

Then, Wrap in plastic bag to protect from scratches

10-07-14

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 60146

Monday, June 28, 2010 9:03:35 AM



Page 7

Item ID: D407-667-105

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Fwd

Start Date: 6/28/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 7/9/2010 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Tool ID

Tool #

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

230

0.00



Crosstubes

Crosstubes

Memo

0.00

Crosstubes

1-Install support using 0.03" to 0.06" thick layer of magnobond 6398 per QSI 015. Let cure for 12h after installation and prior to packaging. Note: (3) top holes should be facing up.

A/R Magnobond 6398 : 114158

IT 10-0775

2-Torque clamps to 80-100 in lb 10 07 19

3-Install nut plates as per Dwg D407-667-145. Touch-up rivet heads with Imron paint. 10 07 19

240

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

8106720



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 60146

Monday, June 28, 2010 9:03:36 AM



Page 8

Item ID: D407-667-105

Accept



Setup Start



Revision ID:

Stop



Item Name: Crosstube Fwd

Start Date: 6/28/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 7/9/2010 Req'd Qty: 1.00



Customer:

Reference:

Run Start



Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Stop



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

250

Pick Kit

0.00



Packaging

Memo

0.00

Packaging

PC 10/7/21 @

260

QC4- 100% Inspect kits for completeness

0.00



QC

Memo

0.00

Quality Control

*8.10.10/21**PC*

270

Packaging

0.00



Packaging

Memo

0.00

Packaging

Identify and pack for shipping as per PPP D407-667-105

Location: _____

PPP Rev: *C**PC 10/7/21 @*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 60146

Monday, June 28, 2010 9:03:36 AM

Page 9

Item ID: D407-667-105

Accept

Setup Start

Revision ID:

Stop

Item Name: Crosstube Fwd

Start Date: 6/28/2010 Start Qty: 1.00

Cust Item ID:

Required Date: 7/9/2010 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

280

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

10/07/22 J

MF

10-7-21

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Monday, June 28, 2010 9:03:40 AM

Page 1

Work Order ID: 60146

Parent Item: D407-667-105

Parent Item Name: Crosstube Fwd

Start Date: 6/28/2010


Required Date: 7/9/2010

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:F 05.09.01 Add holes for compatibility with Bell Skidtubes KJ/JLM
 IPP Rev:G 08-05-16 chg QC6 to QC15 DD verified by:EC
 IPP Rev:H 08-06-03 update as per DSI9415 (ECN1198) DD verified by:ec
 IPP Rev:I 08-07-14 add (scribe inside of tube) seq.6 DD verified by:EC
 IPP Rev:J 08-07-28 update as per (par 08-013) DD verified by:EC
 IPP Rev K 09.01.06 ECN 08-562 EC verified by:DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D407-667-105TRN		Manufactured	No			110	Each	2.0000	1	1			
													
Crosstube Turning Detail													

Location	Loc Qty	Loc Code
LG	2	
58734	1	
58732	1	

D2856-400-694		Manufactured	No			230	Each	0.0000	2	2			
													

Abrasion Strip

D2873-043		Manufactured	No			230	Each	48.0000	2	2			
													

Nut Plate Assembly

Location	Loc Qty	Loc Code
LG	48	
53966	20	
56466	8	
57337	20	

10.07.19

Dart Aerospace Ltd

W/O: 60146		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	
10-07-15		D2856-400 Abrasion strip Non applicable now using D 3595-063-395 rubber strip * per change	ET	10-07-15		(FIXED PER 600145) [Signature]	S 10/02/20	
10-07-15		used D 3595-063-530 B51776 to replace D3595-063-395 no more stock D 3595-063-530 B51776 x4	ET	10-07-15			S 10/02/20	

Part No: D407-667-105 PAR #: _____ Fault Category: _____ NCR: Yes No DOA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Monday, June 28, 2010 9:03:40 AM

Page 2

Work Order ID: 60146

Parent Item: D407-667-105

Parent Item Name: Crosstube Fwd

Start Date: 6/28/2010

Required Date: 7/9/2010

Start Qty: 1.00

Required Qty: 1.00

D2873-045

Manufactured No

230

Each

44.0000

2

2



Nut Plate Assembly

Location

Loc Qty

Loc Code

LG

44

53967

5

53968

20

57336

19

ml 10.07.19

D2891-1

Manufactured No

230

Each

77.0000

2

2



2.25 Support

Location

Loc Qty

Loc Code

LG

77

43880

3

46159

20

50952

18

53347

4

53773

20

55786

12

x2

MS20601-AD4W10

Purchased

No

230

Each

128.0000

14

14



RIVET

Location

Loc Qty

Loc Code

LG051

100

114245

100

ST322

28

113220

28

ml 10.07.19

Monday, June 28, 2010 9:03:40 AM

Shop Packet Print

Page 2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DCA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Monday, June 28, 2010 9:03:40 AM

Page 3

Work Order ID: 60146

Parent Item: D407-667-105

Parent Item Name: Crosstube Fwd

Start Date: 6/28/2010

Required Date: 7/9/2010

Start Qty: 1.00

Required Qty: 1.00

MS21920-20

Purchased

No

230

Each

101.0000

4

4



Clamp (per MIL-DTL-8783C)



25 10-07-14

Location

Loc Qty

Loc Code

LG

101

112624

24

112793

3

114687

50

114779

24

x1

x3

AN5-10A

Purchased

No

250

Each

153.0000

10

10



Bolt



Handwritten signature

Location

Loc Qty

Loc Code

ST337

153

114199

52

114227

1

114752

100

M114752

AN5-30A

Purchased

No

250

Each

112.0000

4

4



BOLT



Handwritten signature

Location

Loc Qty

Loc Code

ST339

112

112933

37

114437

25

114941

50

M112933

Monday, June 28, 2010 9:03:40 AM

Shop Packet Print

Page 3

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DCA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Monday, June 28, 2010 9:03:40 AM

Page 4

Work Order ID: 60146

Parent Item: D407-667-105

Parent Item Name: Crosstube Fwd

Start Date: 6/28/2010

Required Date: 7/9/2010

Start Qty: 1.00

Required Qty: 1.00

AN5-32A

Purchased

No

250

Each

226.0000

Bolt

Location

Loc Qty

Loc Code

ST340

226

113121

26

114056

100

114405

50

115016

50

AN960JD516

NAS1149D0563J

Purchased

No

250

Each

0.0000

Washer

MS21042L5

Purchased

No

250

Each

627.0000

Nut

Location

Loc Qty

Loc Code

ST139

500

114813

500

ST300

127

114449

127

Monday, June 28, 2010 9:03:40 AM

Shop Packet Print

Page 4

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DOA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order:	60144
Description: Crosstube High Fwd (407)	Part Number:	D407-667-105
Inspection Dwg: D407-667-145	Rev: C	Page 1 of 1

Required Dimension	Min	Max
Height	23.41	23.67
1/2 Span	45.81	46.07
Angle	54	56
Total Span	91.63	92.13

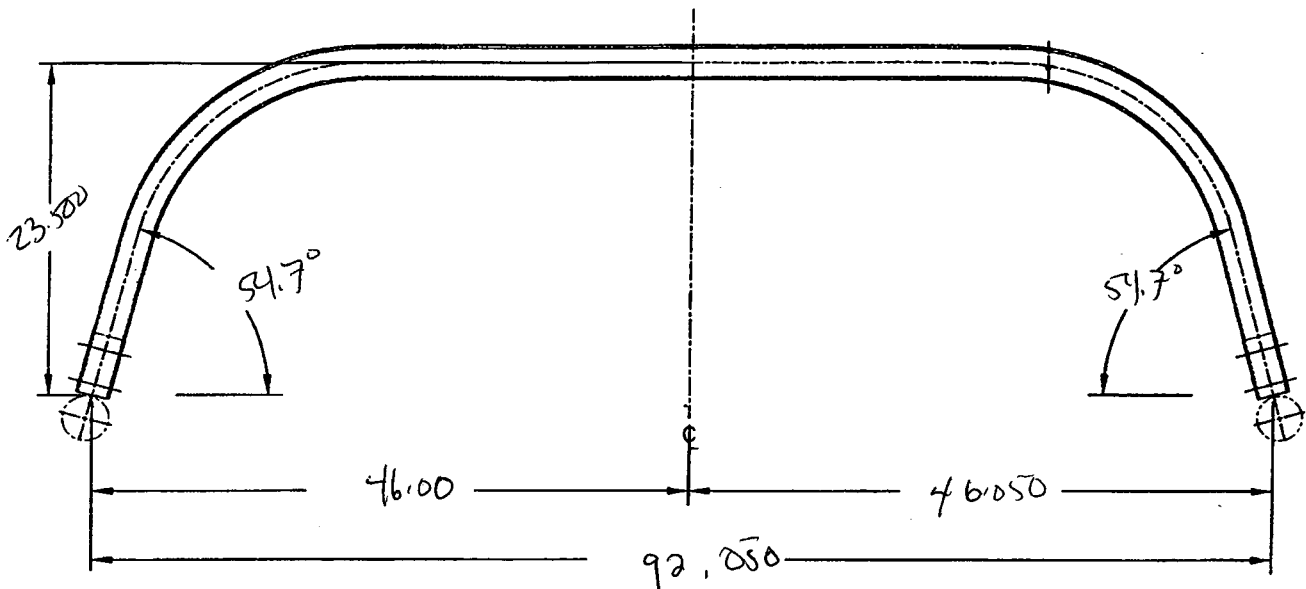

Comments

QC15 Inspection	
Date	10/27/01

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	09.11.12	Dimensions updated per Dwg Rev C	KJ	

W/O:			WORK ORDER CHANGES					
DATE	STEP		PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector	
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

• NOTE: Date & initial all entries

Item	Qty -145	Part Number	Description
1	X	D407-667-145	CROSSTUBE ASSEMBLY (407 HIGH FWD)
2	1	D6010-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2891-1	SUPPORT
6	4	D3595-063-395	RUBBER CUSHION
7	4	MS21920-20	CLAMP (OR MS21920-21)
8	14	MS20601AD4W10	RIVET (OR NAS9302B-4-10)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299- 947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6010-115
FINISHED LENGTH = 113.20±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D407-667-145" AND BATCH NUMBER ON
INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 17.8 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY,
TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 6 PASSES. MAXIMUM TUBE FLATTENING DUE
TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER
QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-20 CLAMPS (OR -21) WITH D3595-063-395 RUBBER CUSHIONS TO SECURE
THE D2891-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS
ARE LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. *60144*
BS10-628

RELEASED
08/11/12

C	REVISE GENERAL NOTES/PART LIST (ZN D7-1); REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS. D3595-063-395 WAS D2856-400-694 (ZN D6-2 & A5-2); REMOVED REF. 7 ADD TOLERANCES (ZN C6-3, C4-3, D2-3); RELOCATED FLAG #6 (ZN A8-3) PER NCR 210; MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	08.11.06
B	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKUDTUBES	PH	05.07.26
A	NEW ISSUE	CP	02.05.06
REV.	DESCRIPTION	BY	DATE
DESIGN	<i>RF</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	<i>RF</i>	DRAWING NO. REV. C D407-667-145 SHEET 1 OF 4	
CHECKED	<i>RF</i>	TITLE SCALE CROSSTUBE ASS'Y (407 HIGH FWD) NTS	
MFG. APPR.	<i>RF</i>	DATE 08.11.06	
APPROVED	<i>RF</i>	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	
DE APPR.	<i>RF</i>		


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DCA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

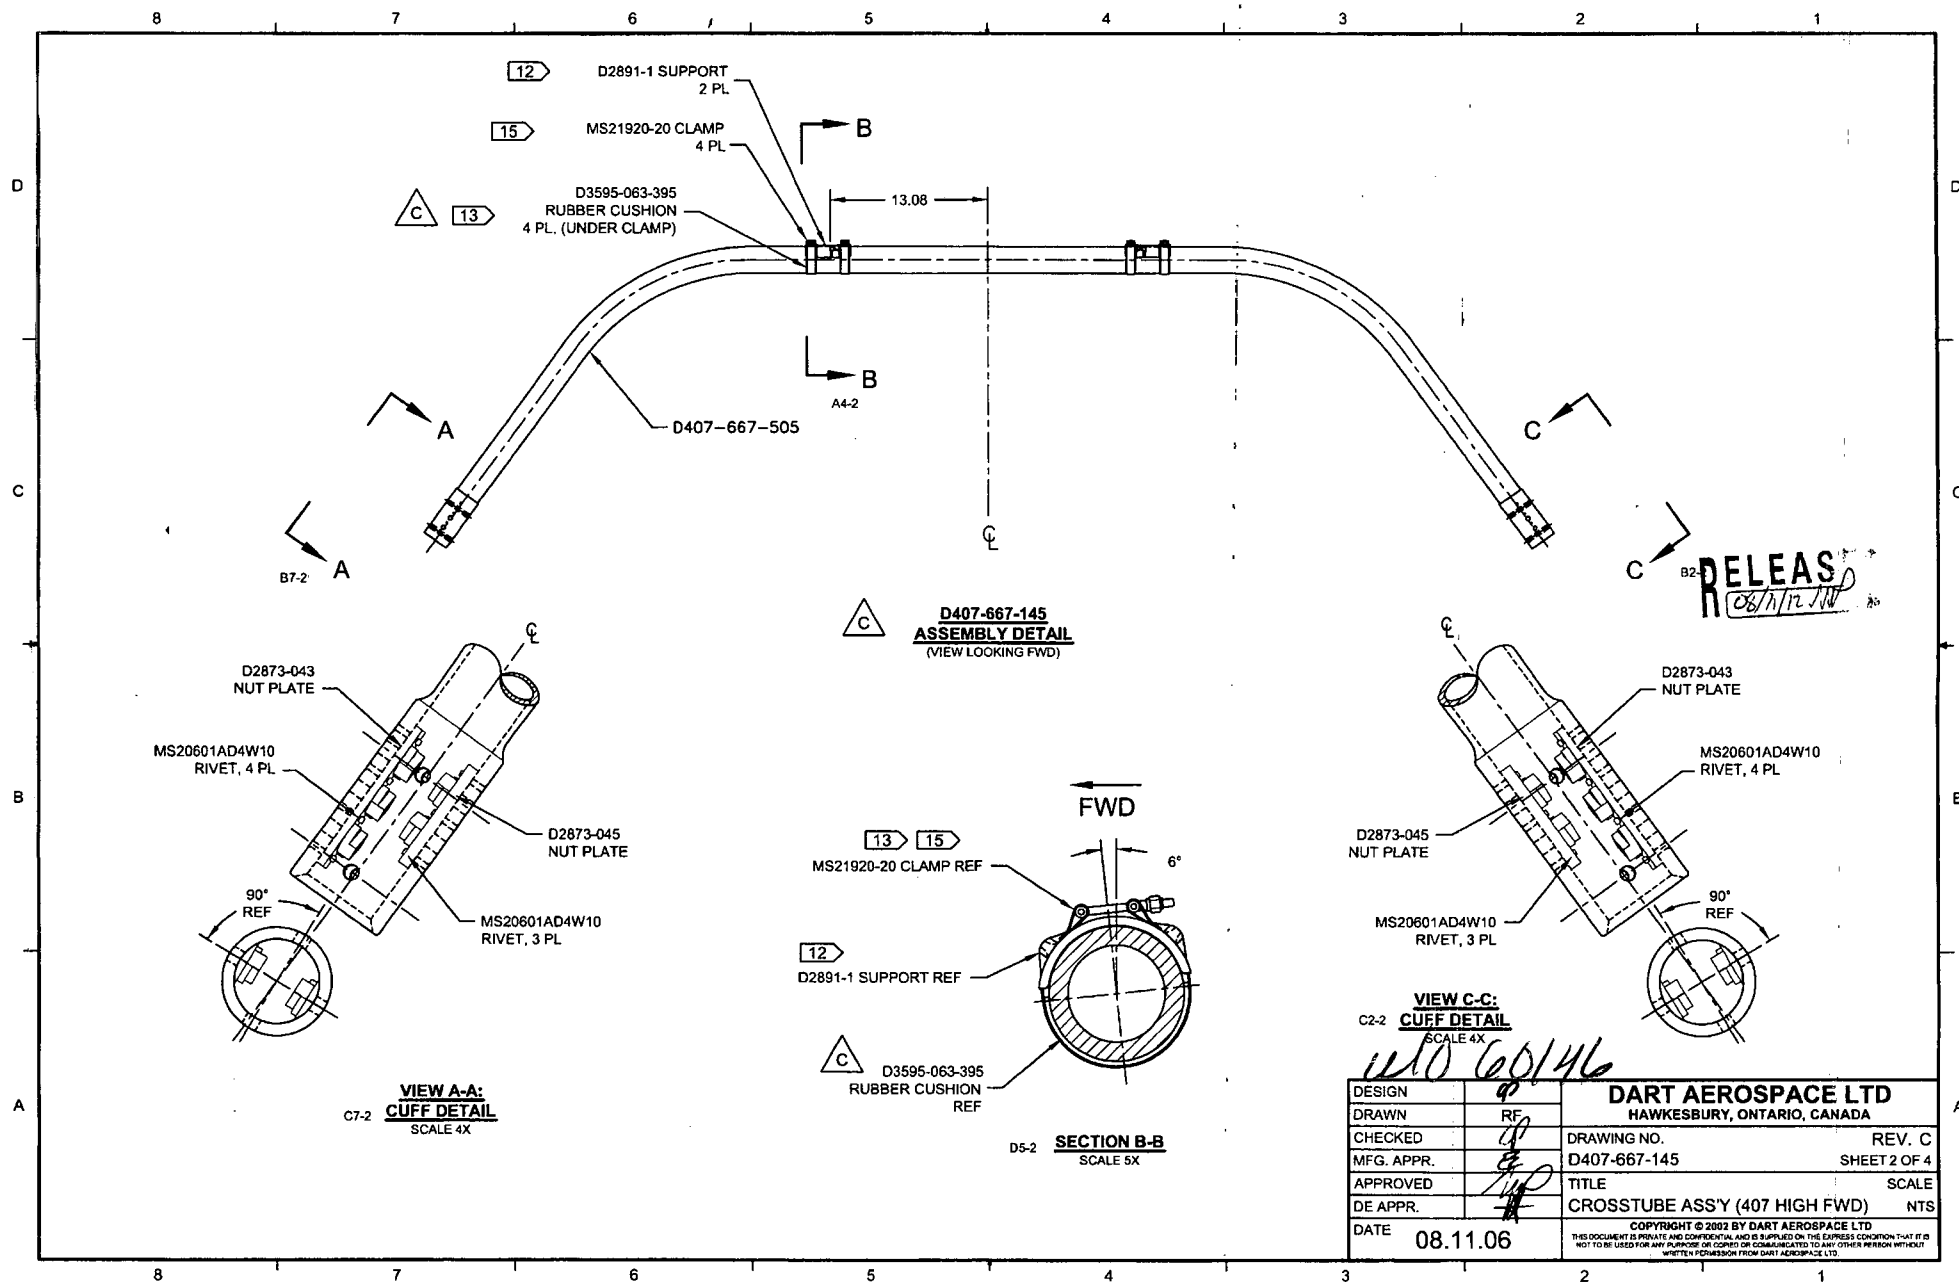

DESIGN	4	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	4	DRAWING NO.	REV. C
MFG. APPR.	4	D407-667-145	SHEET 2 OF 4
APPROVED	4	TITLE	SCALE
DE APPR.	4	CROSSTUBE ASS'Y (407 HIGH FWD)	NTS
DATE	08.11.06	<small>COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

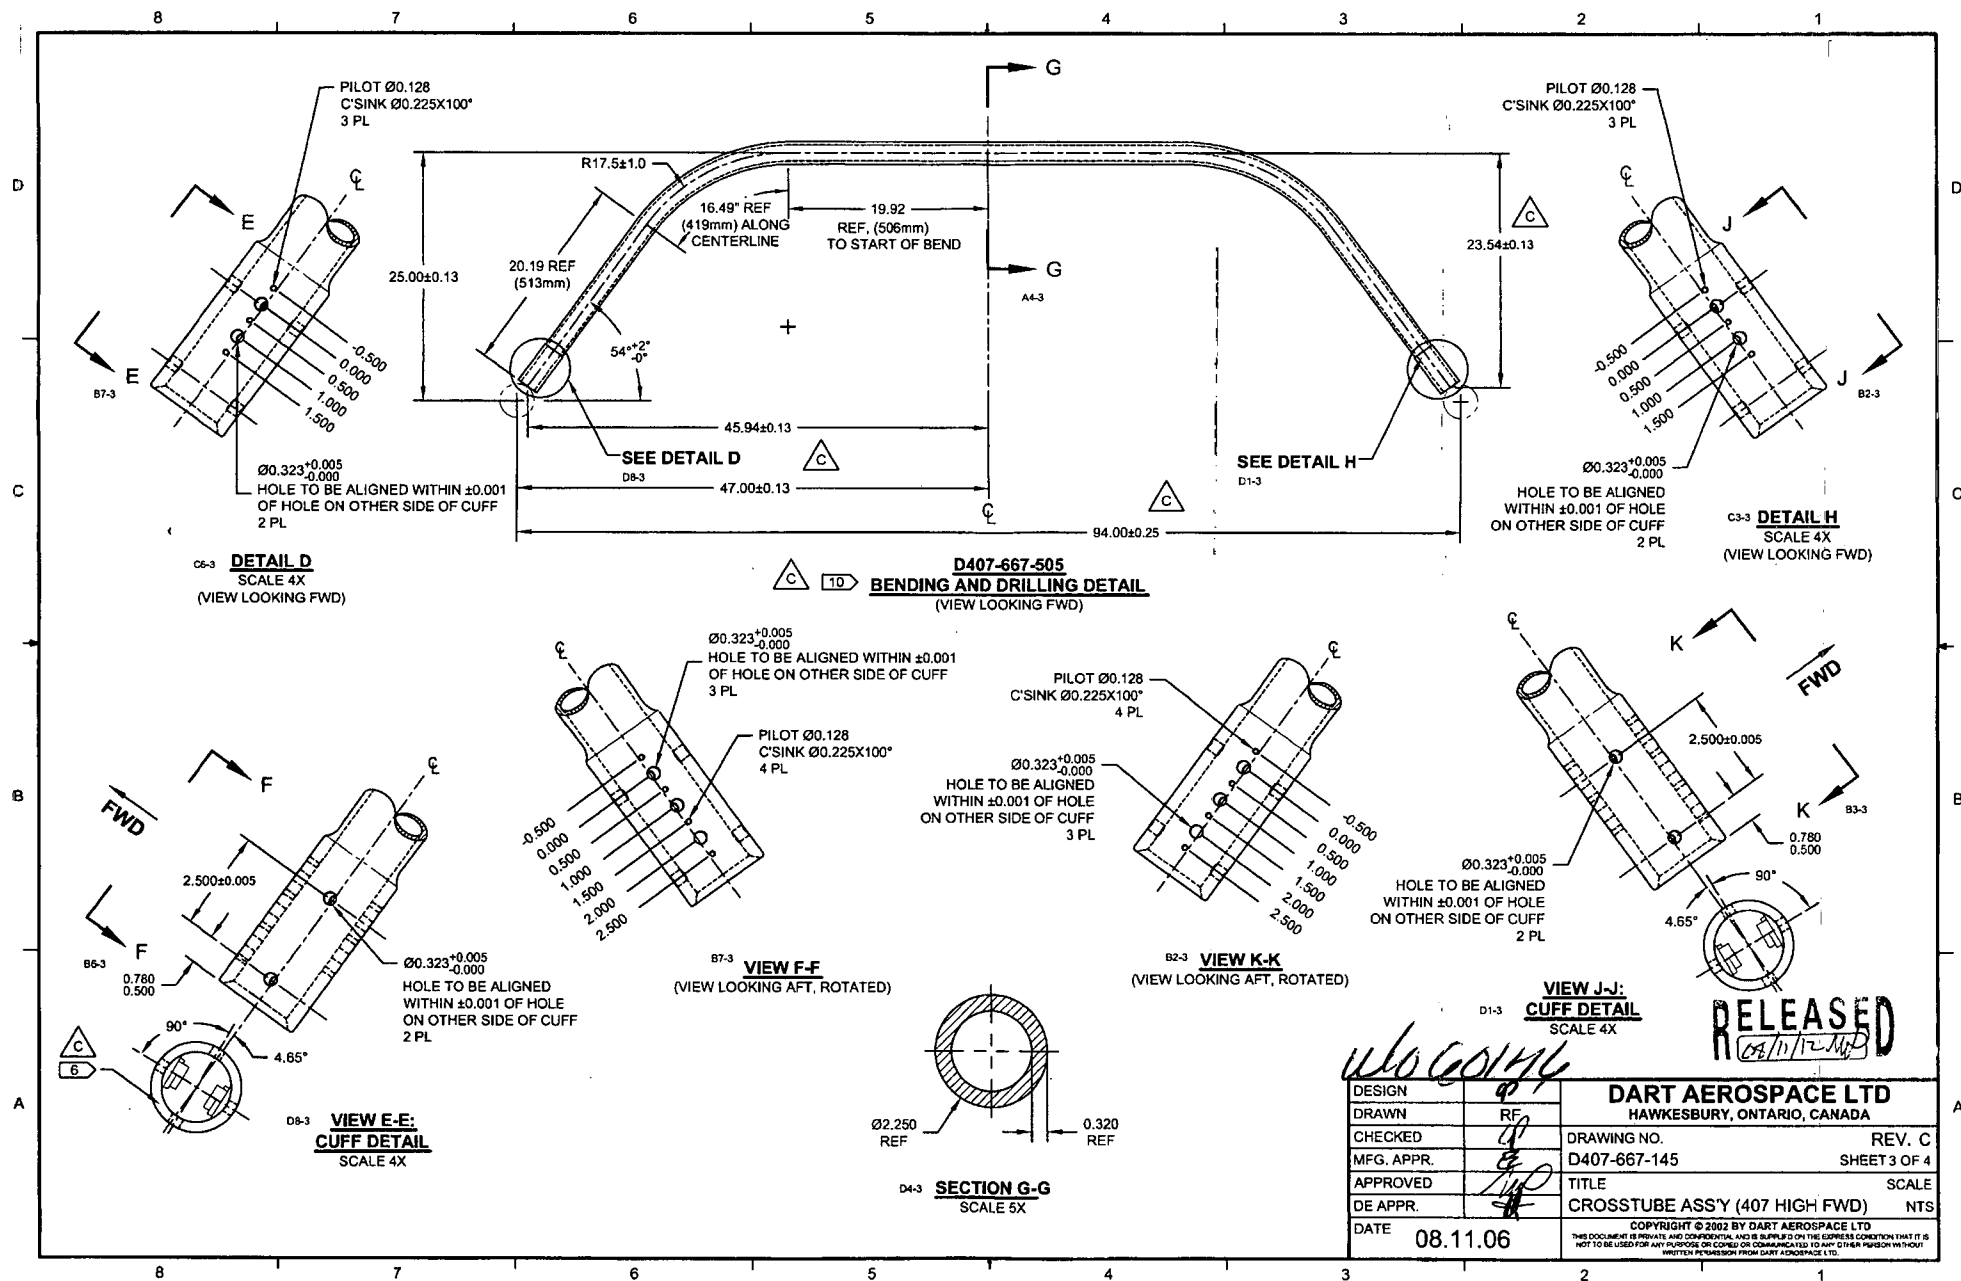


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

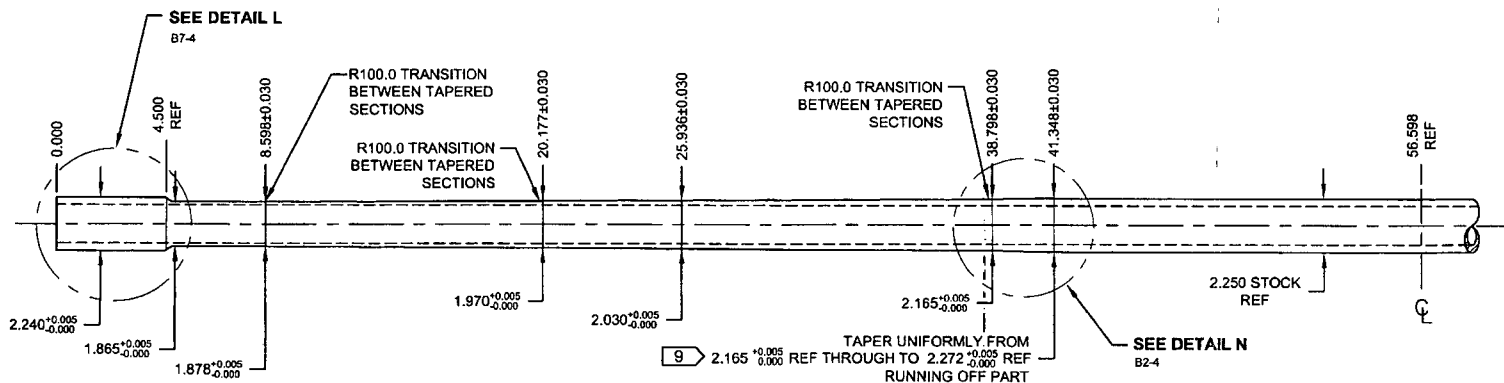


C TURNING DETAIL

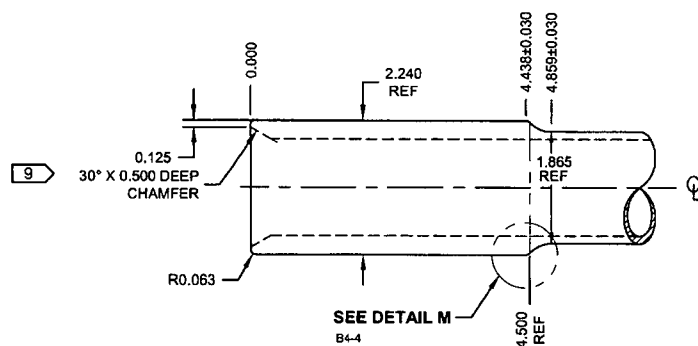

DETAIL L:
D7-4 CROSSTUBE CUFF
NOT TO SCALE

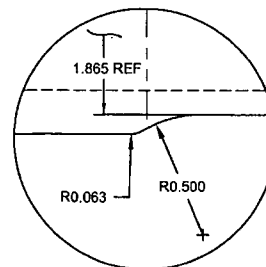

DETAIL M:
B6-4 CUFF TRANSITION
NOT TO SCALE

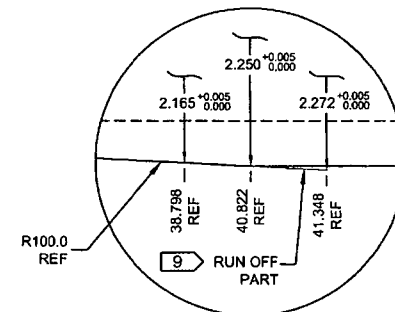

DETAIL N:
C3-4 TAPER RUN-OFF
NOT TO SCALE

RELEASED
08/11/2006

DESIGN	917	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. C
MFG. APPR.	RF	D407-667-145	SHEET 4 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE ASS'Y (407 HIGH FWD)	NTS
DATE	08.11.06	COPYRIGHT © 2002 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



LIQUID PENETRANT TEST REPORT

P- 15181

CLIENT DACT Aerospace DATE Jul 14 7-2010 PAGE 1 OF 1
ATTENTION LINDA/CHANTEL ACUREN JOB NO. 100-10-0777 TIME AM ☒ PM ☐
ADDRESS 1270 ABERDEEN, HAWKESBURY PO/WO NO. —
ONT WORK LOCATION MAIN SHOP - HAWKESBURY
K&H LK7 ACCEPTANCE STD. ASTM 1417 REV./DATE 2007
PROJECT F.P.I. on THREE CROSSTUBES THAT HAD PREVIOUS
ITEM(S) EXAMINED INDICATIONS (SEE REPORT # 15329) & FOUR CROSSTUBES

JOB DESCRIPTION — PROCEDURE NO. LT0002 REV./DATE — TECHNIQUE NO. LT0002 REV./DATE —
PART NO. — MATERIAL STAINLESS STEEL THICKNESS ALUMINUM
SCOPE WET FLUORESCENT LIQUID PENETRANT ALUMINUM
INSPECTION CARRIED OUT 100% EXTERNAL

TEST DETAILS
METHOD ☒ FLUORESCENT ☐ VISIBLE ☒ WATER WASH ☐ SOLVENT REMOVABLE ☐ POST EMULSIFIED
FAMILY BRAND MAGNAFLUX BLACK LIGHT S/N 16454 ☐ OUTPUT > 1000 μ W/cm² ☐ AMBIENT < 2 fc
PENETRANT 2L 67 MINIMUM DWELL TIME 45 MIN. LIGHTING EQUIP. ☐ FLASHLIGHT ☐ TROUBLELIGHT ☐ OUTPUT > 100 fc @ SURFACE
PENETRANT REMOVER H2O MINIMUM DRY TIME >10 MIN. OTHER LABINO
DEVELOPER SKD 52 MINIMUM DWELL TIME 10 MIN. LIGHT METER S/N 1098866 CAL DUE DATE Oct 18
DEVELOPER TYPE ☐ NON AQUEOUS ☐ AQUEOUS ☐ DRY 2010

TEST SURFACE
SURFACE CONDITION ☐ AS GROUND ☐ AS WELDED ☒ MACHINED ☐ SHOT BLASTED ☒ CLEAN BARE METAL
SURFACE TEMPERATURE ☐ < -4°C/20°F ☐ -4°C/20°F TO 10°C/50°F ☒ 10°C/50°F TO 52°C/125°F ☐ > 52°C/125°F

RESULTS- ☐ METRIC ☐ IMPERIAL

1 - CROSSTUBE W.O. 59975	✓
1 - CROSSTUBE W.O. 59976	✓
1 - CROSSTUBE W.O. 58388	✓
1 - CROSSTUBE W.O. 60145	✓
1 - CROSSTUBE W.O. 60146	✓
1 - CROSSTUBE W.O. 59973	✓

NOTE: CROSSTUBES
- W.O. 59975
- W.O. 59976
- W.O. 58388
WERE ON REPORT # 15329.
INDICATIONS WERE LOCATED
- AREAS OF INTEREST WERE
EXAMINED AT THIS TIME AND
FOUND ACCEPTABLE.

Scope of Services
The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

Standard of Care
In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES

CLIENT REPRESENTATIVE <u>Ran Titley</u>	SIGNATURE <u>[Signature]</u>	DTR # <u>E63368</u>
TECHNICIAN (SIGNATURE): <u>[Signature]</u>	NAME <u>Mike Johnston</u>	REPORT REVIEWED BY: <u>—</u>
NAME (PRINT): <u>Mike Johnston</u>	1 ST TECHNICIAN	NAME <u>—</u> INITIALS <u>—</u>
CGSB LEVEL <u>2</u> SNT LEVEL <u>—</u>	2 ND TECHNICIAN	
CGSB REG. NO. <u>66666</u>	CGSB LEVEL <u>—</u> SNT LEVEL <u>—</u>	
	CGSB REG. NO. <u>—</u>	

5.0 PARTS LIST

Item	Qty -011	Qty -013	Qty -015	Qty -101	Qty -201	Qty -103	Qty -203	Qty -105	Qty -205	Part Number	Description
	X									D206-667-011	SPACER BLOCK KIT
		X								D206-667-013	NUT PLATE KIT (-101/-103/-105/-203/-205)
			X							D206-667-015	NUT PLATE KIT (-201)
				X						D206-667-101	CROSSTUBE INSTALLATION, 206A/B HIGH FWD
					X					D206-667-201	CROSSTUBE INSTALLATION, 206A/B HIGH AFT
						X				D206-667-103	CROSSTUBE INSTALLATION, 206L/L-1/L-3/L-4 HIGH FWD
							X			D206-667-203	CROSSTUBE INSTALLATION, 206L/L-1/L-3/L-4 HIGH AFT
								X		D407-667-105	CROSSTUBE INSTALLATION, 407 HIGH FWD
									X	D407-667-205	CROSSTUBE INSTALLATION, 407 HIGH AFT
1				1						D206-667-141	CROSSTUBE ASSEMBLY, 206A/B HIGH FWD
2					1					D206-667-241	CROSSTUBE ASSEMBLY, 206A/B HIGH AFT
3						1				D206-667-143	CROSSTUBE ASSEMBLY, 206L/L-1/L-3/L-4 HIGH FWD
4							1			D206-667-243	CROSSTUBE ASSEMBLY, 206L/L-1/L-3/L-4 HIGH AFT
5								1		D407-667-145	CROSSTUBE ASSEMBLY, 407 HIGH FWD
6									1	D407-667-245	CROSSTUBE ASSEMBLY, 407 HIGH AFT
10				*2	*2	*2		*2		D2891-1	SUPPORT
11							*2			D2892-1	SUPPORT
12									*1	D2894-1	SUPPORT
13				*2	*2	*2		*2		D2856-400-694	ABRASION STRIP
14							*2		*2	D2856-400-773	ABRASION STRIP
15									*1	D2856-600-851	ABRASION STRIP
16				*4	*4	*4		*4		MS21920-20	CLAMP
17							*4		*4	MS21920-22	CLAMP
18									*2	MS21920-24	CLAMP
19				4	4	4		4		AN5-32A	BOLT
20							4		4	AN5-34A	BOLT
21				4	4	4	4	4	4	MS21042L5	NUT (OR MS21042-5)
22				8	8	8	8	8	8	AN960JD516	WASHER
23									*2	D3190-1	CHAFING SHIELD
30	8									AN4-6A	BOLT
31	8									AN4-7A	BOLT
32	16									AN960JD416	WASHER
33	2									D3193-041	SPACER BLOCK ASSEMBLY
40		2		*2		*2	*2	*2	*2	D2873-043	NUT PLATE
41		2		*2		*2	*2	*2	*2	D2873-045	NUT PLATE
42			2		2					D2872-043	NUT PLATE
43			2		2					D2872-045	NUT PLATE
44		10		10		10				AN5-7A	BOLT
45		10	10		10		10	10	10	AN5-10A	BOLT
46		4	4	4	10	4		4		AN5-30A	BOLT
47		4					4		4	AN5-32A	BOLT
48		18	18	10	12	10	10	10	10	AN960JD516	WASHER
49		4	4		6					MS21042L5	NUT (OR MS21042-5)

*REFERENCE ONLY. PARTS ARE INCLUDED IN D206-667-141/241/143/243, & D407-667-145/245 ASSEMBLIES ABOVE

• COPYRIGHT © 2001 BY DART AEROSPACE LTD. •

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Revision: C
Date: 05.07.26